# **Blindsonthenet**

# Zebra Blinds

# **PRODUCT INFORMATION**

# HARDWARE

Colours Cassette / Bottom Rail i. White ii. Ivory iii. Anodised Silver iv. Black

Cord i. White

ii. Ivory

iii. Silver

iv. Black

Cord Length 500mm – 2500mm (in 250mm increments)

Maxim um / Minimum Blind Sizes

Minimum Width :	300mm	
Maximum Width :	2700mm (recommend to keep it under 2600mm)	
Minimum Drop :	600mm	
Maximum Drop :	3000mm (for most fabrics) /	2800mm (for Blackout fabrics)

\*\*Max. Drop varies depending on fabric thickness. Most light filtering fabrics can reach 3000mm, but for the thicker blockout fabrics (such as Valen tine Blackout ser ies) anything more than 2800mm may require an upgrade to our larger 'Wintron' headboxes, which however is only available in WHITE and SILVER at this stage (Jan 2017).

#### VERTICAL VIEWMAX

Because the fabrics are (railroaded ' to create this system, the maximum allowable drop is 2650mm (our Viewty & Sonatine fabrics come in 2800mm width).

Vertical Viewmax is currently only available in a limited range of thin fabrics, due to the technical aspect of this system. The horizontall y vaned fabrics are 'railroaded' to create this vertical effect ; thicker fabrics are incompatible.

\*\*Multiple Blinds in a single Cassette are not available .

# PACKAGING

Each Bl ind will be sleeved and bubble wrapped individually to minimise damage in transit. All blinds will comply with ACCC Child Safety Regulations by way of a warning label on outer packaging, and warning cards & tiebacks that the installer must tag onto the control cords once installed.

#### WARRANTY

Materials and Workmanship are covered for 2 years for normal use of blinds. Warranty does not cover damage from abuse, inappropriate cleaning agents and methods, careless handling, freight, installers mishandling or blinds made outside of recommended sizing limits.

Product failure after 2 years will be assessed and should a legitimate claim be approved a pro rata basis of correction will be applied.

## SUITABLE USES


Dual Shades should be where possible avoided in certain situations:

a. Very breezy or windy locations. [Fabric edges will be damaged].
b. In reach of pets or young children. [No brainer]
c. Constantly moist areas [Mildew will eventually form]
d. In locations where chemicals are strong – e.g.: chlorine from indoor pool or spa.
e. Outdoors.
f. Windows with controls that are re ached for behind the blind. [Fabric edges will be damaged]

# LINING UP VANES IN ADJACENT BLINDS

Blinds situated adjacently will have stripes line up only if:

- i. specified in the order form;
- ii. they are of identical Drop ;
- iii. they are installed with the headbox at exactly the same level .

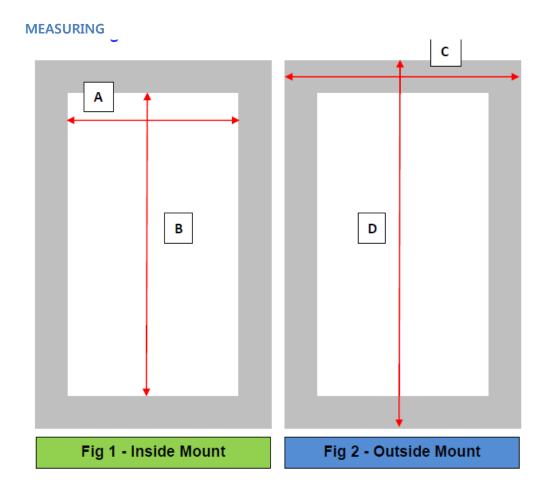

# 1. Inside Mount [Reveal Installation] – SEE Fig 1.

i. Measure inside Reveal at "A" [width] and "B" [drop].

It is important that "A" is measured where the Cassette will be installed, as it is the widest part of the blind. [The Cassette is approximately 30mm wider than the fabric – 20mm (control) & 10mm (idle). **Clearance deduction for the width is 3 – 5mm**.

ii. Unlike other Roller Blinds, the drop measurement is critical to the correct function of the blind. The manufacturing process governs that the blind is in the full stripe overlap position at the specified drop. **We recommend a drop deduction of 5mm – 10mm**.

# 2. Outside Mount [Face Installation]

Measuring for outside mount is not so critical UNLESS there are obstructions to take into account. i. Measure at "C" from Outside of Architrave to Outside of Architrave. **No deductions necessary**. [Additional width can be applied to ensure fabric covers architrave. For Fabric to cover the architrave the width ordered needs to be approx 35mm wider than measurement "C". ii. Measurement "D" is from top of architrave to bottom of architrave. No deductions necessary.

# **INSTALLATION**

Installation of Dual Shades are not so different to other Cassette Roller blind systems. Installation Brackets are Universal [Both Inside and Outside Mount].

At least one bracket should be located as near as possible to the control end of the blind to support the chain operation of the blind; it is vital that the brackets are fitted perfectly horizontally otherwise the blind will roll up crooked and fray the fabric edges. Incorrect installation voids warranty on frayed fabric.

# **CLEANING**

# 1. Cassette and Bottom Rails.

Aluminium Surfaces can be cleaned with a clean soft cloth and normal household mild cleaning agent, but do not allow cleaning agents to come in contact with Fabric under any circumstances.

# 2. Fabric.

DO NOT USE CHEMICAL CLEANERS ON THE FABRIC.

i. General Cleaning

The blind may gather dust and from time to time need cleaning. Use a hair dryer on cold to gently remove dust, or use an anti-static soft brush or cloth to gently attract dust from the fabric. ii. Spot Cleaning

The fabric should be treated carefully and gently when spot cleaning. Use a damp cloth with a very mild detergent and gently "dab" the affected area. Harsh rubbing will remove the stiffening on the fabric and distort is surface. The fabric must not be creased during this process.

## **DYE LOTS**

Minor dye lot variations will arise from time to time. Basic precautions should be taken.

a. Within an order.

If blinds are immediately next to each other in the one location, it is advisable to state this when ordering.

b. Subsequent orders.

Should the same colour fabric be ordered at a later date, it is expected that there will be a dye lot variation.

c. Swatches.

When a customer selects a colour, they should be reminded that dye lot variation can happen,

and the dye lot of the swatch will not be exactly the dye lot of the finished blinds.

# DISCLAIMER

The recommendations in this Information Manual are a guide only. Individual interpretation based on specific jobs, will be necessary.